

Straps




Material, surface finish:
Aluminium EN AW-6063

Sample order:
nlm 21000-020 (1 strap with clamping screw)

Note:

The straps are used to clamp the dovetail slides in the X, Y and Z axes and to fix the slide unit in the machine. The lifting operation will be reduced if the strap is used on the surface.

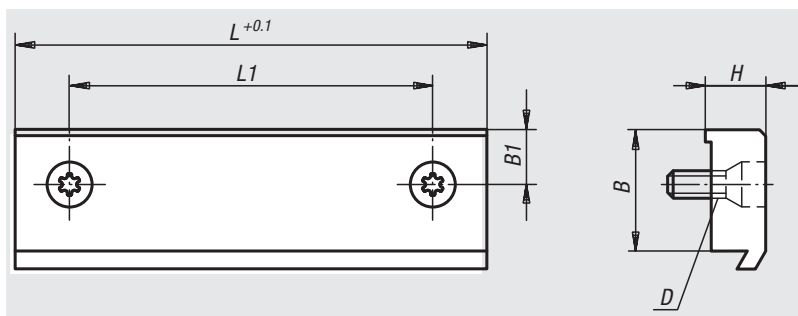

Order No.	B	B1	D for screw	H	L	L1	Stroke reduction	suitable for sliding table
21000-020	5,7	3,7	M2	3,5	19,5	12	3,5	21000-020 ...
21000-030	5,7	2,85	M3	3,5	29,5	23	3,5	21000-030 ...
21000-050	11,5	5,25	M4	8	49,3	38	8	21000-050 ...
21000-080	11,5	6	M5	8	78,9	60	8	21000-080 ...
21000-120	15	10	M5	10	118,4	90	10	21000-120 ...

Fastening screws

for cross table mounting




Material, surface finish:
Steel, annealed

Sample order:
nlm 21000-02055
(Supplied in sets of four)

Note:

Installation kit for setting up a compound table.
Consisting of four fixing screws.

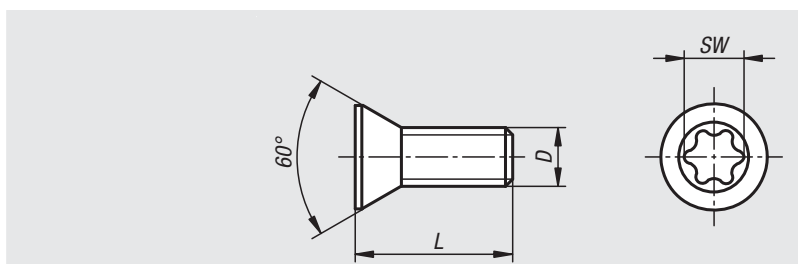

Order No.	D	L	SW	suitable for sliding table	Approx. weight g
21000-02055	M2	5,5	Torx T7	21000-020...	0,3
21000-03070	M3	7	Torx T9	21000-030 ...	0,5
21000-04100	M4	10	Torx T15	21000-050 ...	0,8
21000-05140	M5	14	Torx T20	21000-080 ... / 21000-120 ...	1,5

